

Aruba Instant On 1960 Switch Series Release Notes

Version 2.6.0.73



Copyright Information

© Copyright 2022 Hewlett Packard Enterprise Development LP.

Open Source Code

This product includes code licensed under the GNU General Public License, the GNU Lesser General Public License, and/or certain other open source licenses. A complete machine-readable copy of the source code corresponding to such code is available upon request. This offer is valid to anyone in receipt of this information and shall expire three years following the date of the final distribution of this product version by Hewlett Packard Enterprise Company. To obtain such source code, send a check or money order in the amount of US \$10.00 to:

Hewlett Packard Enterprise Company
6280 America Center Drive
San Jose, CA 95002
USA

Notices

The information contained herein is subject to change without notice. The only warranties for Hewlett Packard Enterprise products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. Hewlett Packard Enterprise shall not be liable for technical or editorial errors or omissions contained herein.

Confidential computer software. Valid license from Hewlett Packard Enterprise required for possession, use, or copying. Consistent with FAR 12.211 and 12.212, Commercial Computer Software, Computer Software Documentation, and Technical Data for Commercial Items are licensed to the U.S. Government under vendor's standard commercial license.

Links to third-party websites take you outside the Hewlett Packard Enterprise website. Hewlett Packard Enterprise has no control over and is not responsible for information outside the Hewlett Packard Enterprise website.

Acknowledgments

All third-party marks are property of their respective owners.

Description

This release note covers software versions for the 2.0 branch of the software. Version 2.6.0.73 is the third release of major version 2.0.

Product series supported by this software:

- Aruba Instant On 1960 Switch Series

Important Information

To avoid damage to your equipment, do not interrupt power to the switch during a software update. Aruba recommends always updating to the latest version of software to ensure the best performance for your switch.

Version History

All released versions are fully supported by Aruba, unless noted in the table.

Version number	Release date	Remarks
2.6.0.73	2022-06-23	Release of version 2.6.0.73 of the Aruba Instant On 1960 software. Released, fully supported, and posted to the web.
2.5.0.67	2022-02-07	Release of version 2.5.0.67 of the Aruba Instant On 1960 software. Released, fully supported, and posted to the web.
2.4.0	2021-11-01	Initial release of the Aruba Instant On 1960 software. Released, fully supported, and posted to the web.

Products Supported

This release applies to the following product models:

Product number	Description
JL805A	Aruba Instant On 1960 12XGT 4SFP+ Switch
JL806A	Aruba Instant On 1960 24G 2XGT 2SFP+ Switch
JL807A	Aruba Instant On 1960 24G 20p Class4 4p Class6 PoE 2XGT 2SFP+ 370W Switch

Product number	Description
JL808A	Aruba Instant On 1960 48G 2XGT 2SFP+ Switch
JL809A	Aruba Instant On 1960 48G 40p Class4 8p Class6 PoE 2XGT 2SFP+ 600W Switch

Compatibility/Interoperability

The switch web agent supports the following web browsers:

Operating system	Browser
Windows 7	Chrome version 87 or higher Firefox version 84 or higher
Windows 10	Chrome version 87 or higher Firefox version 84 or higher
Mac OS X 10.15	Safari version 14 or higher Chrome version 87 or higher Firefox version 84 or higher
Linux OS 2.6, 3.11	Chrome version 87 or higher Firefox version 84 or higher



Aruba recommends using the most recent version of each browser as of the date of this release note.

Enhancements

This section lists released builds that include enhancements found in this branch of the software. Software enhancements are listed in reverse-chronological order, with the newest on the top of the list. Unless otherwise noted, each software version listed includes all enhancements added in earlier versions.

Version 2.6.0.73

Type	Description
SNMP	Removed restriction to allow SNMP management from non-management VLANs.

Version 2.5.0.67

There are no new feature enhancements in this release.

Version 2.4.0

There are no new feature enhancements in this release.

Fixes

This section lists released builds that include fixes found in this branch of the software. Software fixes are listed in reverse-chronological order, with the newest on the top of the list. Unless otherwise noted, each software version listed includes all fixes added in earlier versions.

The Symptom statement describes what a user might experience if this is seen on the network. The Scenario statement provides additional environment details and trigger summaries. When available, the Workaround statement provides a workaround to the issue for customers who decide not to update to this version of software.



The number that precedes the fix description is used for tracking purposes.

Version 2.6.0.73

The following issues are resolved in this release:

Type	Bug ID	Description
Spanning Tree Protocol	26073-0002	Symptom/Scenario: Loops may occur on the network when the TCN (Topology Change Notification) feature is enabled on all switch ports. Workaround: Disable TCN Guard.
WebUI	26073-0001	Symptom/Scenario: The SFP/SFP+ ports tool tip is missing from the graphical Device Image. Workaround: Navigate to the Port Configuration or Event log to identify the transceiver type.

Version 2.5.0.67

The following issues are resolved in this release:

Type	Bug ID	Description
ACL	25067-001	Symptom/Scenario: Second ACL applied to an interface isn't properly saved Workaround: Reboot the device to apply the second ACL
Web UI	25067-002	Symptom/Scenario: The current copyright statement is not up to date. Workaround: N/A

Version 2.4.0

No issues are resolved in this release.

Known Issues

Version 2.6.0.73

Type	Bug ID	Description
Diagnostics	26073-0003	Symptom/Scenario: The Ping Interval time setting is labeled incorrectly as Timeout. Workaround: None.
SNMP	26073-0004	Symptom/Scenario: If the SNMP engine ID field is manually deleted from the Configuration file, an invalid value will be displayed in the webUI. Workaround: Factory reset will regenerate and properly display a unique SNMP engine ID.
VLAN	26073-0005	Symptom/Scenario: VLAN Interface Configuration does not update the ports PVID value when added to a VLAN with untagged membership. Workaround: Modify the port VID manually to match the VLAN in which the port was included.

Version 2.5.0.67

Type	Bug ID	Description
Web UI	25067-003	Symptom/Scenario: The SFP+ ports tool tip is missing from the graphical device Image. Workaround: Navigate to the port configuration or event log to identify the transceiver type.
HTTP	25067-006	Symptom/Scenario: HTTP soft session timeout may fail when using non-default values. Workaround – Utilize the default value (10 minutes).

Version 2.4.0

No known issue are identified in this release.

Contacting Support

Main site	https://www.arubainstanton.com/
Support site	https://support.arubainstanton.com/
Social forums and knowledge base	https://community.arubainstanton.com/
Telephone	https://www.arubainstanton.com/contact-support/
EULA	https://www.arubainstanton.com/eula/
Security	https://www.arubanetworks.com/support-services/security-bulletins/ Email: aruba-sirt@hpe.com